

JAMES

MOTOR CYCLES LIMITED

GREET · BIRMINGHAM 11

TELEPHONE:
VICTORIA 2211 (5 LINES)
Ref. CFH/PT/Service.
OUR REF.



TELEGRAMS:
JAMES GREET BIRMINGHAM
TELEX

YOUR REF


SERVICE BULLETIN NO. 3/57.

AMMETERS - COLONEL MODEL K.12.

Investigation of a few cases of ammeters shorting on the above model shows that this fault is caused by the chafing of the speedometer cable on the rectifier terminal.

This can be overcome by additional insulation of the cable at the point adjacent to the rectifier, a modification which is being incorporated in our 1957 K12 models.

IceniCAM Information Service

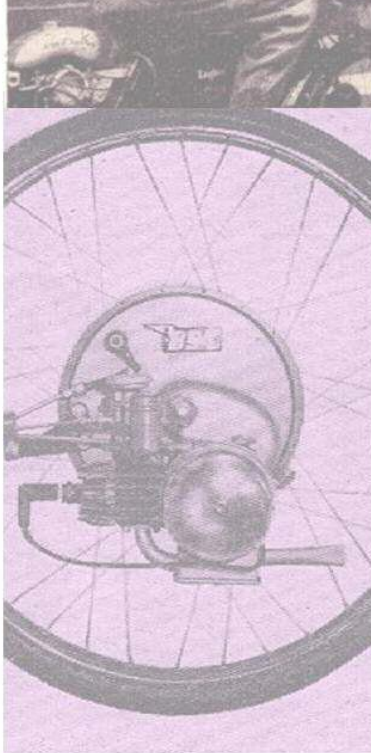

www.icenicam.org.uk