



October, 1958.

LIST No. 559 (Issue No. 2).

Spare Parts List for TYPE 385 CARBURETTER (With Type 334 TWIST GRIP).

COMPONENT	PART NO.
Carburetter complete (less Cables)	385/1
Mixing Chamber Body	385/001
Top Cap for ditto	308/040
Cable Adjuster	308/041
Locknut for ditto	308/042
Throttle Valve No. 1	308/125
Throttle Valve Spring	308/038
Throttle Nipple	308/051
Jet Needle	385/006
Jet Needle Clip	308/044
Needle Jet, .0745	385/007
Plug for Needle Chamber	385/004
Washer for ditto	385/016
Main Jet	376/076
Cover for Main Jet	385/005
Washer for ditto	116/162
Feed Hole Plug Screw	333/016
Washer for ditto	333/038
Outlet Clip	360/024
Outlet Clip Screw	335/051
Outlet Clip Nut	335/052
Stud for Air Intake	385/009
Air Filter Plates	360/030
Air Silencer	385/008
Air Silencer Securing Screw	385/010
Air Silencer Securing Screw Washer	385/014
Float Chamber Cover	385/002
Joint Washer for ditto	360/022
Securing Screws	352/209
Float and Needle, complete	308/019
Cold Start Needle	385/013
Spring for ditto	14/032
Sealing Ring for ditto	385/015
Sealing Ring Washer	116/147
Cup Washer	360/052
Stop Peg for ditto	360/053
Twist Grip, complete	334/1
Body, Top Half	334/001
Body, Bottom Half	334/002
Body Fixing Screws	376/079
Rotors (less Rubbers)	334/003
Rubber Grip	334/005
Friction Spring	366/007
Screw for Friction Spring	366/008
Twist Grip Nipple	334/004
Dummy Grip	334/006
Throttle Cable Assembly	244/1376
Decompressor Cable	244/1377
No. 2I Solderless Nipple, complete	—

GUARANTEE.—The Company take all possible reasonable care in the manufacture and the quality of their products. Purchasers are informed that, any part proved to be defective in manufacture or quality, and returned to the works within six months of its purchase new, will be replaced. The Company must respectfully point out however, that its responsibility and that of its agents, stockists and dealers, is limited to this Guarantee, and that they cannot under any circumstances, be held responsible for any loss or for any contingent or resulting liability arising through any defect. These conditions of sale and use also apply when the Company's products form part of the original equipment of machines purchased new.

1,000/10/58. W.

Printed in England


**AMAL LTD., HOLDFORD ROAD, WITTON,
BIRMINGHAM 6, ENGLAND**

'Phone : Birmingham, BIRchfields 4571.
(P.B.X. 6 lines)


Telegrams : "AMALCARB, 'PHONE.
BIRMINGHAM."



DUMMY GRIP 334/006




376/079

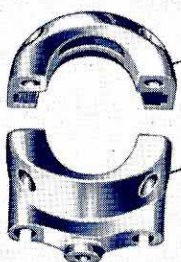

334/001

334/002

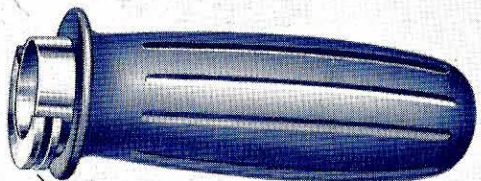


ROTOR 334/003

RUBBER GRIP 334/005



THROTTLE
CABLE
COMPLETE
244/1376

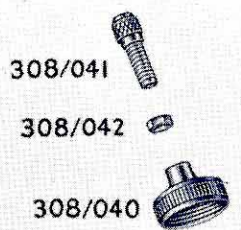


308/041

308/042


308/040




308/038




308/125




308/044



366/007




366/008




352/209




385/002




385/015



116/147




14/032




360/052

385/013



360/053



352/209



DE-COMPRESSOR
CABLE
COMPLETE
244/1377

SOLDERLESS
NIPPLE & SCREW
№ 21



360/022



308/019

385/006


385/001

385/008



385/014

385/010

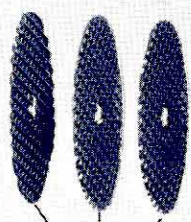


360/030




385/009

333/038

333/016



376/076




385/007




116/162

385/016



385/005



385/004



360/024




335/051



335/052

AMAL
CARBURETTER
TYPE 385

IceniCAM Information Service

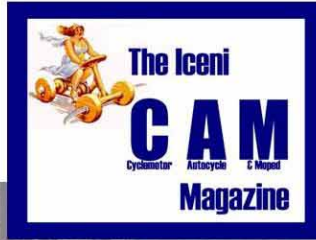

www.icenicam.org.uk